

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave.St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-018120**Date Inspected:** 14-Nov-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Zhu Zhong Hai**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Orthotropic Box Girder(OBG)**Summary of Items Observed:**

On this day CALTRANS OSM Quality Assurance (QA) Inspector Manoj Prabhune was present during the times noted above for observations relative to the fabrication of the SAS Superstructure being performed by Zhenhua Port Machinery Company (ZPMC) at Changxing Island in Shanghai, China. QA observed and/or found the following:

This QA Inspector randomly observed the following work in progress:

OBG TRIAL ASSEMBLY YARD

WELDING:**Segment 11DW**

This QA Inspector observed ZPMC qualified welding personnel identified as 046709 perform Shielded Metal Arc Welding (SMAW), weld joint identified as SEG071A-043; located On Orthotropic Box Girder (OBG) Bottom Plate to Side Plate CJP Weld. The Welding Repair Report (WRR) was B-WR16939. ZPMC QC is identified as Mr.Zhu Zhong Hai. The welding parameters measured using QC's calibrated instrument appeared to be in general compliance with applicable WPS-345-SMAW 4G (4F) FCM-Repair-1. See attached photo for further details.

Segment 11DW

This QA Inspector observed ZPMC qualified welding personnel identified as 040611 perform Shielded Metal Arc Welding (SMAW), weld joint identified as SEG071A-021; located On Orthotropic Box Girder (OBG) Bottom

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

Plate to Side Plate CJP Weld. The Welding Repair Report (WRR) was B-WR16940. ZPMC QC is identified as Mr. Zhu Zhong Hai. The welding parameters measured using QC's calibrated instrument appeared to be in general compliance with applicable WPS-345-SMAW 4G (4F) FCM-Repair-1.

Segment 11CE ~ 11DE

This QA Inspector observed ZPMC qualified welding personnel identified as 067752 perform Shielded Metal Arc Welding (SMAW), weld joint identified as OBE11C-007; located On Orthotropic Box Girder (OBG) Side Plate to Side Plate Transverse CJP Weld; ZPMC Quality Control (QC) is identified as Mr. Wang Li Yang. The welding variables recorded by QC appeared to comply with applicable WPS-B-P-2214-B-U2-FCM-1. See attached photo for further details.

Segment 11CE ~ 11DE

This QA Inspector observed ZPMC qualified welding personnel identified as 050289 perform Shielded Metal Arc Welding (SMAW), weld joint identified as OBE11C-006; located On Orthotropic Box Girder (OBG) Side Plate to Side Plate Transverse CJP Weld; ZPMC Quality Control (QC) is identified as Mr. Wang Li Yang. The welding variables recorded by QC appeared to comply with applicable WPS-B-P-2214-B-U2-FCM-1.

Segment 11DE

This QA Inspector observed ZPMC qualified welding personnel identified as 053871 perform Shielded Metal Arc Welding (SMAW), weld joint identified as SEG072A-044; located On Orthotropic Box Girder (OBG) Bottom Plate to Side Plate CJP Weld; ZPMC Quality Control (QC) is identified as Mr. Wang Li Yang. The welding variables recorded by QC appeared to comply with applicable WPS-B-P-2214-B-U2-FCM-1.

Segment 11EW

This QA Inspector observed ZPMC qualified welding personnel identified as 044551 perform Shielded Metal Arc Welding (SMAW), weld joint identified as SEG073B-001; located On Orthotropic Box Girder (OBG) Longitudinal Diaphragm to Floor Beam CJP Weld; ZPMC Quality Control (QC) is identified as Mr. Zhou Peng. The welding variables recorded by QC appeared to comply with applicable WPS-B-P-2214-TC-U4b-FCM-1.

HEAT STRAIGHTENING


This QA Inspector observed the following work in progress:

ZPMC personnel heat straightening Orthotropic Box Girder (OBG) member identified as Segment 11EE Panel Point 107 Floor Beam. Distortion appeared to be caused by Welding. ZPMC Quality Control (QC) inspector identified as Mr. Wang Li Yang was present to monitor the heat straightening process. The heat straightening appeared to comply with Heat Straightening Report HSR1 (B) 9265.

Unless otherwise noted, all work observed on this date appeared to generally comply with the applicable contract documents.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

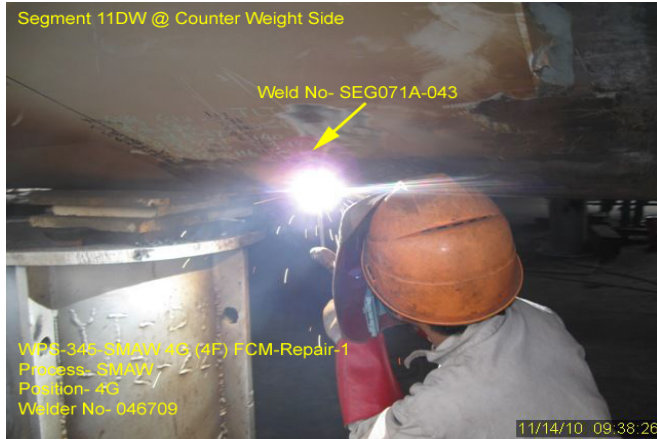

Summary of Conversations:

No significant conversations were reported on this date.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang phone: 15000422372, who represents the Office of Structural Materials for your project.

Inspected By:	Prabhune,Manoj	Quality Assurance Inspector
Reviewed By:	Peterson,Art	QA Reviewer
